

HUNTER TRUCK

HUNTER JERSEY PETERBILT
454 NORTH BROADWAY ST
PENNSVILLE, NJ 08070
P: (856) 299-5010
F: (856) 299-5020

BILL TO
JIM COMLY - 36296
PENNSVILLE NJ 08070

DELIVER TO
JIM COMLY - 36296
PENNSVILLE NJ 08070
P: 000-0000

SERVICE ESTIMATE: E206000209

DATE ARRIVED		DATE INVOICE	SALES TYPE	ADVISOR	TERMS	CUSTOMER REFERENCE		
04/10/2019 7:33:36AM			SRET	R MCGINNIS	CASH	EST		
YEAR	MAKE	MODEL	VIN	CUSTOMER UNIT #	ENGINE HOURS	IN SERVICE	Component Serial #	ODOMETER
2015	PETERBILT	CONVENTIONAL	1NPSLH0X7FD205031	5	2,485		75027295	351751

JOB #1 32-000 CRANKING - SYSTEM

COMPLAINT CRANKING - SYSTEM
DURING VEHICLE INSPECTIONS, FOUND BATTERIES FAILED

CAUSE BATTERIES

CORRECTION PERFORMED INSPECTION ON VEHICLE. UNIT WOULD NOT START. CHECKED AND FOUND BATTERIES FAILED. ATTEMPTED TO CHARGE AND JUMP, BUT TRUCK WOULD DIE IMMEDIATELY AFTER JUMP PACKS REMOVED. SWAPPED BATTERIES FROM ANOTHER TRUCK. TRUCK NOW STARTS AND RUNS. SWAPPED BATTERIES BACK TO CORRECT TRUCKS. RECOMMEND BATTERY REPLACEMENT.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR HT-013	USED VEHICLE CHECK		375.00

Parts: \$0 Labor: \$375.00 Misc: \$0 Sublet: \$0 \$375.00

JOB #2 45-000 ENGINE - SYSTEM

COMPLAINT ENGINE - SYSTEM
DURING INSPECTIONS, FOUND CHECK ENGINE LIGHT IS ON

CAUSE CHECK ENGINE LIGHT

CORRECTION DURING INSPECTIONS, FOUND FAULTS PRESENT IN THE ECM FOR TURBOCHARGER INTAKE TEMPERATURE VOLTAGE HIGH, CYLINDER MISFIRE ON ALL CYLINDERS, AND COOLANT LEVEL FAULTS. ADDITIONAL DIAGNOSTICS WILL BE NEEDED TO FIND ROOT CAUSE OF EACH FAILURE.

THE FOLLOWING IS AN ESTIMATE TO DIAG FAULTS. ADDITIONAL TIME AND PARTS WILL BE NEEDED ONCE FAILURE IS IDENTIFIED

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC2	ASSIGNED MAINTENANCE COST 2	10.50	10.50
	LABOR 45-000-24	ENGINE – SYSTEM - REPAIR		405.00

Parts: \$0 Labor: \$405.00 Misc: \$10.50 Sublet: \$0 \$415.50

HUNTER TRUCK

SERVICE ESTIMATE: E206000209

JOB #3 13-000 BRAKES - AIR SYSTEM

COMPLAINT BRAKES - AIR SYSTEM
DURING INSPECTIONS, FOUND ABS LIGHT ACTIVE

CAUSE WHEEL SPEED SENSOR

CORRECTION PULLED ABS FAULTS AND FOUND FAULTS FOR ADDITIONAL AXLE WHEEL SPEED SENSORS. PERFORMED VISUAL INSPECTIONS ON BOTH SENSORS, FINDING NO OBVIOUS SIGNS OF DAMAGES TO SENSORS. ADDITIONAL DIAGNOSTICS WILL BE NEEDED TO FIND ROOT CAUSE OF BOTH ADDITIONAL AXLE WHEEL SPEED SENSOR FAULTS.

THE FOLLOWING IS AN ESTIMATE TO DIAG THE ABS FAULTS. ADDITIONAL PARTS AND LABOR WILL BE NEEDED ONCE FAILURE IS IDENTIFIED

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC1	ASSIGNED MAINTENANCE COST 1	5.50	5.50
	LABOR 13-000-24	BRAKES – AIR SYSTEM - REPAIR		250.00
Parts: \$0 Labor: \$250.00 Misc: \$5.50 Sublet: \$0				\$255.50

JOB #4 45-000 ENGINE - SYSTEM

ESTIMATE

COMPLAINT ENGINE - SYSTEM
DURING INSPECTIONS, FOUND FRONT END DAMAGE TO UNIT

CAUSE FRONT END DAMAGE

CORRECTION DURING INSPECTIONS, FOUND FRONT BUMPER, GRILL, HOOD, CONDENSOR, CAC AND POWER STEERING FLUID COOLER CORE DAMAGED. RECOMMEND REPLACEMENT OF ALL COMPONENTS.

THE FOLLOWING IS AN ESTIMATE TO REPLACE THE BUMPER, GRILL, HOOD, AC CONDENSOR, CAC AND POWER STEERING COOLER

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC5	ASSIGNED MAINTENANCE COST 5	36.40	36.40
1	AMC	PAINT	2,000.00	2,000.00
1	206P/ED333002	CAC ASSY-SERVICE	1,811.59	1,811.59
2	206P/L11-6133	BRACKET-GUIDE HOOD	181.71	363.42
2	206P/L11-6178	BRACKET-HOOD GUIDE 365 STL	230.61	461.22
1	206P/L29-6073-1200020	HOOD-365 SF NON-PRIMED TILT W/	7,206.15	7,206.15
1	206P/L45-6031	GRILLE-HOOD SST 365/367	772.03	772.03
1	206P/L48-6135	PIVOT-HOOD, LH ASSY	602.05	602.05
1	206P/L48-6136	PIVOT-HOOD, RH ASSY	602.05	602.05
1	206P/N4148001	COOLER-AUX ASSY SERVICE	616.74	616.74
1	206P/R0440001	CONDENSOR ASSY	487.38	487.38
1	206P/TU08V0010-02NS	PB 10GA CHRM, 16" TAPER *D	413.58	413.58
	LABOR 45-000-24	ENGINE – SYSTEM - REPAIR		1,350.00
Parts: \$13,336.21 Labor: \$1,350.00 Misc: \$2,036.40 Sublet: \$0				\$16,722.61

HUNTER TRUCK

SERVICE ESTIMATE: E206000209

JOB #5 02-000 CAB - SYSTEM

COMPLAINT CAB - SYSTEM
DURING INSPECTIONS, FOUND PASSENGER SIDE WINDSHIELD BROKEN
CAUSE WINDSHIELD
CORRECTION DURING INSPECTIONS, FOUND PASSENGER SIDE WINDSHIELD BROKEN. RECOMMEND REPLACEMENT.

THE FOLLOWING IS AN ESTIMATE TO REPLACE THE PASSENGER SIDE WINDSHIELD

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 02-000-24	CAB – SYSTEM - REPAIR		187.50
1	206P/20-14898-20R	GLASS-WINDSHIELD ENCAPSULATED	110.57	110.57
1	206P/28-00236-0000	SEAL - BUTYL 27 FT ROLL	5.13	5.13

Parts: \$115.70 Labor: \$187.50 Misc: \$0 Sublet: \$0 \$303.20

JOB #6 51-000 GENERAL ACCESSORIES

COMPLAINT GENERAL ACCESSORIES
DURING INSPECTIONS, FOUND AIR HORN INOP
CAUSE AIR HORN
CORRECTION DURING INSPECTIONS, FOUND AIR HORN INOP. COULD BE AIR SUPPLY ISSUE TO HORN OR HORN FAILURE.
ADDITIONAL DIAG WILL BE NEEDED TO FIND ROOT CAUSE OF FAILURE.

THE FOLLOWING IS AN ESTIMATE TO REPLACE THE AIR HORN

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	206P/H00871CP	HORN ASSY-24.5"X6" CHROME W/SH	153.62	153.62
	LABOR 51-000-24	GENERAL ACCESSORIES - REPAIR		62.50

Parts: \$153.62 Labor: \$62.50 Misc: \$0 Sublet: \$0 \$216.12

JOB #7 02-000 CAB - SYSTEM

COMPLAINT CAB - SYSTEM
DURING INSPECTION, FOUND WIPER BLADES NEED REPLACED
CAUSE WIPER BLADES
CORRECTION DURING INSPECTIONS, FOUND WIPER BLADE RUBBER DAMAGED AND SHOULD BE REPLACED.

THE FOLLOWING IS AN ESTIMATE TO REPLACE THE WIPER BLADES

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 02-000-24	CAB – SYSTEM - REPAIR		25.00
2	206P/31-18	BLADE-WIPER	3.71	7.42

Parts: \$7.42 Labor: \$25.00 Misc: \$0 Sublet: \$0 \$32.42

HUNTER TRUCK

SERVICE ESTIMATE: E206000209

JOB #8 22-000 DRIVE AXLE - SYSTEM

COMPLAINT DRIVE AXLE - SYSTEM
DURING INSPECTIONS, FOUND FORWARD REAR CARRIER LEAKING

CAUSE CARRIER

CORRECTION DURING INSPECTIONS, FOUND FORWARD REAR TO BE LEAKING OIL. UPON CLOSER INSPECTION, FOUND OIL LEAKING AROUND MATING SURFACE OF CARRIER AND CARRIER HOUSING. RECOMMEND REMOVING CARRIER, RESEALING AND REINSTALLING.

THE FOLLOWINGS IS AN ESTIMATE TO RESEAL THE REAR CARRIER.

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC2	ASSIGNED MAINTENANCE COST 2	10.50	10.50
2	206P/03-01568	GASKET-AXLE SHAFT	3.39	6.78
1	206P/82194PTX	(PX) GASKET MAKER-ULTRA GRY *D	8.56	8.56
	LABOR 22-000-24	DRIVE AXLE – SYSTEM - REPAIR		500.00

Parts: \$15.34 Labor: \$500.00 Misc: \$10.50 Sublet: \$0 \$525.84

JOB #9 02-000 CAB - SYSTEM

COMPLAINT CAB - SYSTEM
DURING VEHICLE INSPECTION, FOUND BOTH QUARTER FENDERS BROKEN

CAUSE QUARTER FENDERS

CORRECTION DURING VEHICLE INSPECTIONS, FOUND BOTH QUARTER FENDERS BROKEN. RECOMMEND REPLACEMENT.

THE FOLLOWING IS AN ESTIMATE TO REPLACE BOTH FRONT QUARTER FENDERS

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 02-000-24	CAB – SYSTEM - REPAIR		250.00
1	AMC1	ASSIGNED MAINTENANCE COST 1	5.50	5.50
1	206P/L33-6027	SKIRT-FENDER,365 SFFA	273.70	273.70
1	206P/L33-6027R	SKIRT-FENDER,365 SFFA	273.70	273.70

Parts: \$547.40 Labor: \$250.00 Misc: \$5.50 Sublet: \$0 \$802.90

JOB #10 11-000 STEER AXLE - SYSTEM

COMPLAINT STEER AXLE - SYSTEM
DURING VEHICLE INSPECTIONS, FOUND BOTH STEER AXLE HUB CAPS LEAK FLUID

CAUSE HUB CAPS

CORRECTION DURING INSPECTIONS, FOUND BOTH STEER AXLE HUB CAPS LEAK FLUID, RECOMMEND REPLACEMENT.

THE FOLLOWING IS AN ESTIMATE TO REPLACE THE STEER AXLE HUB CAPS

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 11-000-24	STEER AXLE – SYSTEM - REPAIR		62.50
2	206P/1613CHR	HUBCAP *D	28.20	56.40

Parts: \$56.40 Labor: \$62.50 Misc: \$0 Sublet: \$0 \$118.90

ESTIMATE

HUNTER TRUCK

SERVICE ESTIMATE: E206000209

JOB #11 13-000 BRAKES - AIR SYSTEM

COMPLAINT BRAKES - AIR SYSTEM
DURING INSPECTIONS, FOUND AIR SYSTEM TO HAVE MULTIPLE LEAKS

CAUSE AIR LEAKS

CORRECTION DURING INSPECTIONS, FOUND UNIT TO HAVE MULTIPLE LEAKS PRESENT. AIR SYSTEM DRAINS DOWN IN VERY SHORT TIME FOLLOWING ENGINE BEING SHUT DOWN. RECOMMEND FURTHER DIAG AND REPAIR OF AIR SYSTEM.

THE FOLLOWING IS AN ESTIMATE TO FIND ALL AIR LEAKS AND REPLACE FITTINGS AS NEEDED

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC1	ASSIGNED MAINTENANCE COST 1	5.50	5.50
1	AMC	MISC FITTINGS AND LINES	50.00	50.00
	LABOR 13-000-24	BRAKES – AIR SYSTEM - REPAIR		250.00
1	206P/40242R	LAMP-STOP/TAIL, RED K37 *D	8.96	8.96

Parts: \$8.96 Labor: \$250.00 Misc: \$55.50 Sublet: \$0 \$314.46

JOB #12 34-000 LIGHTING - SYSTEM

ESTIMATE

COMPLAINT LIGHTING - SYSTEM
DURING INSPECTION, FOUND MULTIPLE LIGHTS OUT

CAUSE LIGHTS

CORRECTION DURING INSPECTIONS, FOUND P/S HEAD LAMP INOP AND DRIVER SIDE TURN SIGNAL INOP. COMMON FAILURES ARE BULBS, BUT WIRING ISSUES COULD BE PRESENT. FURTHER DIAGNOSTICS WOULD BE NEEDED TO FIND ROOT CAUSE OF FAILURE.

THE FOLLOWING IS AN ESTIMATE TO REPLACE INOP BULBS

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
2	206P/2-2207H	LENS & REFLECTOR-HEADLAMP	219.76	439.52
2	206P/9003LLBULB	BULB-HEADLAMP SEALED HEADLI	25.47	50.94
1	206P/9500P	LOADLIGHT-FLUSH CLEAR	61.56	61.56
	LABOR 34-000-24	LIGHTING – SYSTEM - REPAIR		62.50

Parts: \$552.02 Labor: \$62.50 Misc: \$0 Sublet: \$0 \$614.52

JOB #13 13-000 BRAKES - AIR SYSTEM

COMPLAINT BRAKES - AIR SYSTEM
DURING INSPECTIONS, FOUND BRAKE PEDAL STICKING

CAUSE BRAKE PEDAL

CORRECTION DURING INSPECTIONS, FOUND BRAKE PEDAL STICKING. COMMON FAILURES ARE EITHER THE BRAKE PEDAL PIN OR BRAKE VALVE. FURTHER DIAG WOULD BE NEEDED TO VERIFY ROOT CAUSE OF FAILURE.

THE FOLLOWING IS AN ESTIMATE TO REPLACE SEIZED BRAKE PEDAL PIN

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC1	ASSIGNED MAINTENANCE COST 1	5.50	5.50
	LABOR 13-000-24	BRAKES – AIR SYSTEM - REPAIR		125.00
1	206P/238888BXW	PIN-IDLER *D	9.06	9.06

Parts: \$9.06 Labor: \$125.00 Misc: \$5.50 Sublet: \$0 \$139.56

HUNTER TRUCK

SERVICE ESTIMATE: E206000209

JOB #14 17-000 TIRES - SYSTEM

COMPLAINT TIRES - SYSTEM
DURING INSPECTIONS, FOUND BOTH LIFT AXLE TIRES NEED REPLACED, AND RR OUTER WHEEL CRACKED
CAUSE TIRES/WHEEL
CORRECTION DURING INSPECTIONS, FOUND BOTH LIFT AXLE TIRES NEED REPLACED, AND RR OUTER WHEEL CRACKED.
RECOMMEND REPLACEMENT OF TIRES AND DAMAGED WHEEL.

THE FOLLOWING IS AN ESTIMATE TO REPLACE THE BROKEN WHEEL AND WORN TIRES

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
1	AMC1	ASSIGNED MAINTENANCE COST 1	5.50	5.50
2	AMC	LIFT AXLE TIRE (GT GAM835) 315/80R22.5	640.99	1,281.98
	LABOR 17-000-24	TIRES – SYSTEM - REPAIR		312.50
1	206P/98U637	(AL) WHEEL-ALUM,24.5X8.25LVL*D	367.85	367.85

Parts: \$367.85 Labor: \$312.50 Misc: \$1,287.48 Sublet: \$0 \$1,967.83

JOB #15 02-000 CAB - SYSTEM

COMPLAINT CAB - SYSTEM
DURING INSPECTIONS, FOUND HOOD CABLES WORN
CAUSE HOOD CABLES
CORRECTION DURING INSPECTIONS, FOUND HOOD CABLES NEED REPLACED. RECOMMEND REPLACEMENT.

THE FOLLOWING IS AN ESTIMATE TO REPLACE HOOD CABLES

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE
	LABOR 02-000-24	CAB – SYSTEM - REPAIR		25.00
2	206P/L92-6017-0995	CABLE-HOOD STOP 995MM	31.69	63.38

Parts: \$63.38 Labor: \$25.00 Misc: \$0 Sublet: \$0 \$88.38

TERMS OF SALE

- 1) All sales are cash, unless other arrangements have been made. If charging, all amounts are due and payable net ten prox (Due by the 10th of the month following billing). No discounts permitted.
- 2) All past due amounts are subject to a service charge of 1 ½ % per month (18% per annum) on all past due balances.
- 3) No returns on electrical. No returns on special order items or items not returnable to the manufacturer. A restocking charge of 15% will apply on all other returns. Returns must be made within 30 days to receive credit.
- 4) Cores must be returned within 30 days to receive credit.
- 5) The seller hereby certifies that these goods were produced in compliance with all applicable requirements of sections 6, 7 and 12 of the Fair Labor Standards Act of 1938, as amended and of the regulations and orders of the administrator or wage and hour division issues under section 14 thereof.
- 6) By providing sales tax exemption number, customer certifies he is exempt from any sales or occupation tax and agrees if he is ruled to be not exempt by taxing authorities he will be responsible for any tax assessment made by the state of PA or another taxing authority and agrees to reimburse seller for any amount now due or becoming due, including penalties and interest, if assessed. In addition, buyer agrees to pay costs of pat due collection, including reasonable attorney's fees.
- 7) NO REFUND WITHOUT THIS NOTICE

WARRANTY

ANY WARRANTIES ON THE PRODUCTS SOLD ARE AVAILABLE ONLY FROM THE MANUFACTURER OR REBUILDER OF SAID PRODUCTS.
THE SELLER AGREES TO PASS TO CUSTOMER ANY AVAILABLE WARRANTIES. THE SELLER MAKES NO WARRANTIES OF ANY PRODUCTS
SOLD AND AUTHORIZES NO PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF THE PRODUCTS SHOW.
THE SELLER IS NOT RESPONSIBLE FOR LABOR ON PARTS NOT INSTALLED BY OUR SHOP.

LABOR	\$4,242.50
PARTS	\$15,233.36
MISC	\$3,416.88
SUBLET	\$0.00
SUBTOTAL	\$22,892.74
SHOP SUPPLIES	\$0.00
MISC SUPPLIES	\$0.00
TAX	\$1,516.64
TOTAL	\$24,409.38

Please Remit Payment to:

HUNTER JERSEY PETERBILT
PO BOX 820849
PHILADELPHIA, PA 19182-0849

AUTHORIZED BY _____ DATE _____