



Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948	Invoice Number:	806630
	Invoice Date:	1/26/2017
	Location:	84
	Work Order Number:	140564
	Payment Type:	Finance
Page:		1 of 13

Deliver To:

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948
--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1552	1RW9530TTAP912403	107619W	08W-388

Gen- Retail
COMPLAINT:
CHECK TRANS NOISE

CORRECTION:



Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948	Invoice Number:	806630
	Invoice Date:	1/26/2017
	Location:	84
	Work Order Number:	140564
	Payment Type:	Finance
Page:		2 of 13

Deliver To:

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948
--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1552	1RW9530TTAP912403	107619W	08W-388

Gen- Retail

- We drove the tractor out in the field to listen to the noise coming from in front of the cab.

The noise was coming from the transmission when we drove in 9th gear or higher.

- The tractor will be coming into the shop to be repaired.

- Cab was already removed in earlier segment

- Drain oil from transmission

- Drain oil from rear end

- Disconnect input drive shaft

- Slide shaft away from transmission

- Unbolt hydraulic pump stack

- Slide pump back and tie up in place

- Disconnect oil line to front of transmission

- Remove cover over harnesses

- Remove harness from protective housing

- Remove line clamps from harness

- Disconnect harness from steering pump and filter housing

- Remove ground connection

- Set harness aside

- Remove steering filter housing

- Disconnect oil lines to steering pump

- Unbolt and remove steering pump assembly

- Remove output drive shaft

- Slide away from transmission

- Disconnect all oil lines to rear of transmission

- Unbolt and remove LH rear transmission mount

- Disconnect transmission oil cooler

- Unbolt battery cable harness from transmission

- Install lifting brackets on transmission

- Unbolt transmission


- Install hoist and lift up and remove transmission assembly

- Remove bottom transmission mounts

- Install transmission tool on roll over stand

- Bolt transmission up to roll over stand

CONTINUED ON NEXT PAGE->

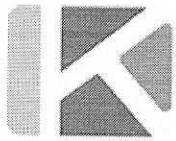

**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948	<table> <tr> <td>Invoice Number:</td><td>806630</td></tr> <tr> <td>Invoice Date:</td><td>1/26/2017</td></tr> <tr> <td>Location:</td><td>84</td></tr> <tr> <td>Work Order Number:</td><td>140564</td></tr> <tr> <td>Payment Type:</td><td>Finance</td></tr> <tr> <td>Page:</td><td>3 of 13</td></tr> </table>	Invoice Number:	806630	Invoice Date:	1/26/2017	Location:	84	Work Order Number:	140564	Payment Type:	Finance	Page:	3 of 13
Invoice Number:	806630												
Invoice Date:	1/26/2017												
Location:	84												
Work Order Number:	140564												
Payment Type:	Finance												
Page:	3 of 13												

Deliver To:

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948
--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1552	1RW9530TTAP912403	107619W	08W-388

- Remove hoist
- Remove oil lines from transmission
- Remove harness from transmission
- Unbolt and remove steering pump drive assembly
- Remove parking brake assembly
- Remove drive yokes
- Install lifting hooks on transmission cover
- Unbolt cover from transmission
- Lift up and remove cover
- Look at gears
- Found gear teeth broke off
- Reinstall transmission cover
- Roll over transmission
- Remove pump drive housing cover
- Remove oil pump drive gear
- Pull off and remove input shaft bearing
- Pull off and remove drive gear
- Flip over transmission
- Remove transmission cover
- Install lifting device over all shaft
- Secure in place
- Lift out and remove all shafts and set in holder
- Inspect all gears carefully
- Found 3 bad gears
- Stages 2, 3, and 4
- Remove stage 2 shaft from holder
- Install puller tools and remove top bearing
- Remove snap ring
- Install puller tools and remove top gear with bearing
- Install puller and remove inner bearing
- Remove snap ring securing clutch pack disks and plates
- Remove all clutch disks and plates
- Put assembly in press

CONTINUED ON NEXT PAGE->



Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948	Invoice Number:	806630
	Invoice Date:	1/26/2017
	Location:	84
	Work Order Number:	140564
	Payment Type:	Finance
Page:		4 of 13


Deliver To:

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948
--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1552	1RW9530TTAP912403	107619W	08W-388

- Press down bevel washers and remove snap ring
- Remove bevel washers
- Lift out and remove clutch pack piston
- Flip over shaft assembly
- Install puller tools and remove bottom bearing
- Install puller tools and remove bottom gear assembly
- Remove snap ring securing clutch plates and disks
- Remove all clutch disks and plates
- Install assembly in press
- Press down bevel washers
- Remove snap ring and all bevel washers
- Pull out and remove clutch piston
- Replace shaft/Drum/Gear assembly
- Install new piston packings on shaft
- Install new packing on bottom piston
- Install piston in bottom drum
- Put in press and reinstall bevel washers and snap ring
- Install alignment tool and reinstall clutch disks and plates
- Install snap ring to secure in place
- Remove alignment tool
- Pressurize clutch assembly and check travel of clutch pack
- Found travel to much so clutch disks are worn
- Remove snap ring and all clutch disks and plates
- Reinstall alignment tool and install clutch plates with new disks
- Secure with snap ring and remove alignment tool
- Check travel of clutch pack
- Travel in spec now
- Install inner bearings
- Aligning clutch disks with gear assembly install on shaft
- Install bearing in gear
- Heat up new lower shaft bearing
- Install bearing on shaft
- Flip over assembly
- Install new packing on clutch piston

CONTINUED ON NEXT PAGE->

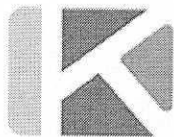

**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948	Invoice Number: 806630 Invoice Date: 1/26/2017 Location: 84 Work Order Number: 140564 Payment Type: Finance Page: 5 of 13
--	--


Deliver To:

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948
--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1552	1RW9530TTAP912403	107619W	08W-388

- Install new packing on clutch piston
- Install piston in drum
- Install bevel washers with press and secure with snap ring
- Heat up new bearing and install in clutch drum
- Replace race in gear assembly
- Install alignment tool
- Install clutch plates and new disks in clutch assembly
- Remove alignment tool and check clutch travel
- Travel in spec
- Aligning clutch plates install upper gear assembly
- Heat up bearing and install in gear
- Heat up new upper bearing and install on shaft
- Reinstall shaft in holder
- Repeat procedure for shaft stages 3 and 4
- Remove top bearing for stage 1
- Install new top bearing on stage 1
- Replace top and bottom bearing cups from shafts 2, 3, and 4
- Replace top bearing cup for stage one
- Clean out transmission cases
- Clean all sealing surfaces
- Install tool over all shaft assemblies
- Lift shaft assemblies and install carefully in transmission case
- Install new sealing rings on all shaft assemblies
- Coat case flange in sealant
- Lower transmission case cover over shafts down on sealing rings
- Bolt covers back together
- Flip over transmission
- Check and adjust end play off 1, 2, 3, and 4th stage shafts
- Push on pump drive gear on input shaft
- Reinstall pump drive idler gear
- Heat up new bearing and install on input shaft
- Replace input shaft bearing cup
- Install sealant on pump drive housing and reinstall on transmission
- Check and adjust end play of input shaft

CONTINUED ON NEXT PAGE->

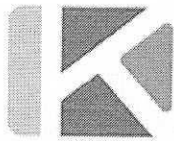

**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948	<table> <tr> <td>Invoice Number:</td><td>806630</td></tr> <tr> <td>Invoice Date:</td><td>1/26/2017</td></tr> <tr> <td>Location:</td><td>84</td></tr> <tr> <td>Work Order Number:</td><td>140564</td></tr> <tr> <td>Payment Type:</td><td>Finance</td></tr> <tr> <td>Page:</td><td>6 of 13</td></tr> </table>	Invoice Number:	806630	Invoice Date:	1/26/2017	Location:	84	Work Order Number:	140564	Payment Type:	Finance	Page:	6 of 13
Invoice Number:	806630												
Invoice Date:	1/26/2017												
Location:	84												
Work Order Number:	140564												
Payment Type:	Finance												
Page:	6 of 13												


Deliver To:

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948
--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1552	1RW9530TTAP912403	107619W	08W-388

- Install new input shaft seal
- Reinstall drive yoke
- Replace packings on park clutch pack piston
- Reinstall park clutch pack piston
- Reassemble park clutch pack and install cover
- Install new out put shaft seal
- Reinstall drive yoke
- Reinstall transmission wiring harness
- Reinstall oil lines
- Reinstall steering pump drive assembly
- Install hoist and remove from roll over stand
- Install transmission in tractor
- Connect oil cooler lines
- Reinstall LH rear mount
- Bolt transmission down in place
- Reinstall output drive shaft
- Reinstall steering pump
- Hook up all oil lines to pump
- Reinstall steering filter assembly
- Replace steering and transmission oil filters
- Connect input drive shaft
- Install hydraulic oil pump stack
- Hook up oil lines to rear of transmission
- Hook up oil line to front of transmission
- Reinstall wiring harness over transmission
- Hook up harness
- Tie harness in place
- Reinstall protective housing over harness
- Installed cab ***Cab reinstalled in separate segment***
- Fill transmission and rear end with new cenex oil
- Wash off transmission
- Drive and test operation
- Calibrate transmission

CONTINUED ON NEXT PAGE->

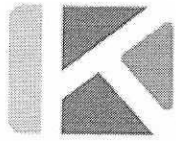

**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948	Invoice Number: 806630 Invoice Date: 1/26/2017 Location: 84 Work Order Number: 140564 Payment Type: Finance Page: 7 of 13
--	---

Deliver To:


BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948
--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1552	1RW9530TTAP912403	107619W	08W-388

- Check for any leaks

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
4295829	O-Ring	1.00	5.55	5.55	\$5.55	N
F37030221	O-RING	4.00	3.45	3.45	\$13.80	N
F37030273	O-RING	1.00	8.17	8.17	\$8.17	N
F37040329	O-RING	1.00	1.19	1.19	\$1.19	N
PM38657	Sealant - HIGH FLEX FORM-IN-PLACE GASKET	2.00	19.92	19.92	\$39.84	Y
R10093	O-RING	2.00	1.30	1.30	\$2.60	N
R183409	O-RING	2.00	1.30	1.30	\$2.60	N
RE174130	FILTER	1.00	83.73	83.73	\$83.73	N
RE519144	SENSOR	1.00	33.56	33.56	\$33.56	N
RE576834	RECEIVER DRYER	1.00	47.90	47.90	\$47.90	N
RE61567	BEARING CO	2.00	62.40	62.40	\$124.80	N
RE69054	FILTER ELE	1.00	45.35	45.35	\$45.35	N
T155995	O-Ring	1.00	31.31	31.31	\$31.31	N
T72895	O-Ring	6.00	5.37	5.37	\$32.22	N
T77613	O-RING	2.00	1.58	1.58	\$3.16	N
T78313	O-RING	2.00	4.31	4.31	\$8.62	N
T78612	O-RING	1.00	2.55	2.55	\$2.55	N

CONTINUED ON NEXT PAGE->

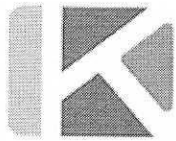

**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948	Invoice Number: 806630 Invoice Date: 1/26/2017 Location: 84 Work Order Number: 140564 Payment Type: Finance Page: 8 of 13
--	---

Deliver To:


BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948
--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1552	1RW9530TTAP912403	107619W	08W-388

Gen- Retail

TY26101	BRAKE AND PARTS CLEANER-US ONLY	4.00	5.23	5.23	\$20.92	Y
U12037	O-RING	2.00	3.54	3.54	\$7.08	N
U12331	O-RING	1.00	4.93	4.93	\$4.93	N
YZ250161	Seal	17.00	8.67	8.67	\$147.39	N
YZ501022	Piston Ring	6.00	4.08	4.08	\$24.48	N
YZ501131	Tapered Roller Bearing	3.00	102.20	102.20	\$306.60	N
YZ501568	BEARING CU	1.00	24.30	24.30	\$24.30	N
YZ501569	BEARING CO	1.00	58.16	58.16	\$58.16	N
YZ501589	Bearing Cone	4.00	66.08	66.08	\$264.32	N
YZ501621A	Shim	2.00	2.99	2.99	\$5.98	N
YZ501621B	Shim	1.00	2.99	2.99	\$2.99	N
YZ501621D	Shim	1.00	12.16	12.16	\$12.16	N
YZ501788	Clutch Plate	60.00	33.76	33.76	\$2,025.60	N
YZ501845	Seal	1.00	10.42	10.42	\$10.42	N
YZ501846	Seal	1.00	13.05	13.05	\$13.05	N
YZ501847	Ring	1.00	3.59	3.59	\$3.59	N
YZ501881	O-Ring	1.00	6.68	6.68	\$6.68	N
YZ502060	WASHER	3.00	5.32	5.32	\$15.96	N
YZ502125	Bearing Cup	6.00	49.57	49.57	\$297.42	N
YZ502126	BEARING CO	1.00	64.87	64.87	\$64.87	N

CONTINUED ON NEXT PAGE->

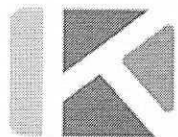

**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948	Invoice Number: 806630 Invoice Date: 1/26/2017 Location: 84 Work Order Number: 140564 Payment Type: Finance Page: 9 of 13
---	---

Deliver To:

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1552	1RW9530TTAP912403	107619W	08W-388

Gen- Retail

YZ502127	Bearing Cup	1.00	53.55	53.55	\$53.55	N
YZ502166	SEAL	2.00	33.95	33.95	\$67.90	N
YZ502209	Shaft	2.00	3,667.47	3,667.47	\$7,334.94	N
YZ502214	Shaft	1.00	3,667.47	3,667.47	\$3,667.47	N
YZ502232	O-RING	2.00	6.39	6.39	\$12.78	N
YZ502316	V-RING SEA	1.00	17.63	17.63	\$17.63	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
EPA	EPA	2.00	2.00	2.00	\$4.00	N
FREIGHT	FREIGHT	1.00	152.33	152.33	\$152.33	N
Labor: \$10,380.00		Parts: \$14,958.12	OL&M: \$0.00	Misc: \$156.33	Sub-Total: \$25,494.45	


Gen2- Retail

COMPLAINT:
PICK-UP CHARGE

CORRECTION:

<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
PROMOTRUCK	PROMO TRUCKING EXPENSE	1.00	200.00	200.00	\$200.00	N
Labor: \$0.00		Parts: \$0.00	OL&M: \$0.00	Misc: \$200.00	Sub-Total: \$200.00	

CONTINUED ON NEXT PAGE->

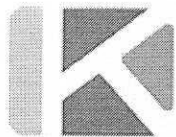

**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER
57756 - 119TH ST
MAPLETON MN 56065

Bus Phone: 507-524-3784

Prv Phone:

Mob Phone: 507-327-1948

Invoice Number: **806630**

Invoice Date: 1/26/2017

Location: 84

Work Order Number: 140564

Payment Type: Finance

Page: 10 of 13

Deliver To:

BRIAN JAEGER
57756 - 119TH ST
MAPLETON MN 56065

Bus Phone: 507-524-3784

Prv Phone:

Mob Phone: 507-327-1948

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1552	1RW9530TTAP912403	107619W	08W-388

Gen10- Retail

COMPLAINT:

Remove and Install cab

CORRECTION:

CONTINUED ON NEXT PAGE->



Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948	Invoice Number:	806630
	Invoice Date:	1/26/2017
	Location:	84
	Work Order Number:	140564
	Payment Type:	Finance
Page:		11 of 13

Deliver To:

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948
--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1552	1RW9530TTAP912403	107619W	08W-388


Gen10- Retail

REMOVE CAB

- Cleaned up containers
- Drained coolant from engine
- Drained hydraulic oil from reservoir
- Tipped hood forward in service position
- Disconnected all oil lines to reservoir
- Disconnected electrical connectors
- Unbolted reservoir
- Removed reservoir from tractor
- Disconnected oil lines to brake and steering valves
- Marked all lines
- Disconnect electrical connectors
- Remove alternator output wire
- Remove clamps from wire
- Disconnect wire from fuse box
- Send cable with cab
- Disconnect washer fluid lines
- Disconnect cab air pipes and tube
- Unhook harness to pressurizer fan
- Evacuate AC from system
- Disconnect AC lines to cab
- Remove rear controller panel cover
- Remove controllers from rear over cab and set aside
- Unplug harnesses from rear panel of cab
- Install lifting bracket on top of cab
- Remove all cab mount bolts
- Lift up and remove cab

INSTALL CAB

- Replace cab mounts
- Reinstall cab back on tractor
- Bolt cab back down to tractor

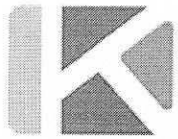

**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948	Invoice Number: 806630 Invoice Date: 1/26/2017 Location: 84 Work Order Number: 140564 Payment Type: Finance Page: 12 of 13
--	--

Deliver To:


BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948
--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1552	1RW9530TTAP912403	107619W	08W-388

- Reinstall harnesses Back to cab rear panel
- Bolt controllers back up to cab panel
- Plug all connectors back in
- Reinstall cover over cab rear panel
- Plug in harness to pressurizing fan
- Hook up cab air ducts and tube
- Remove lifting bracket from cab roof
- Hook up AC lines
- Replace receiver dryer
- Hook up all oil lines to brake and steering valves
- Hook up electrical connectors
- Hook up washer fluid lines
- Reinstall alternator output harness
- Rout and hook up to alternator
- Bolt all line clamps in place
- Hook up harness to fuse
- Install hydraulic reservoir
- Hook up all oil lines to reservoir
- Bolt reservoir in place
- Hook up electrical connectors to reservoir
- Refill hydraulic reservoir with oil drained out
- Fill cooling svstem with coolant drained out

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
RE62901	Isolator	4.00	43.76	43.76	\$175.04	N

CONTINUED ON NEXT PAGE->

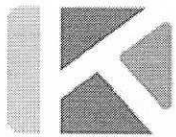

**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948	Invoice Number: 806630 Invoice Date: 1/26/2017 Location: 84 Work Order Number: 140564 Payment Type: Finance Page: 13 of 13
--	---

Deliver To:

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948
--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1552	1RW9530TTAP912403	107619W	08W-388

Gen10- Retail							
RE62910	Isolator		4.00	70.72	70.72	\$282.88	N
Labor: \$1,020.00		Parts: \$457.92	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,477.92		

Miscellaneous Charges:	
SERVICE ACCESSORIES	\$100.00

Finance Information

Type: Multi-use Acct US **Auth. No:** 962654
Merchant No: 44000445
Card No: xxxxxxxxxxxx4527
Bill Code: 704 - JD TRACTOR PARTS/SERVICE
Credit Plan: 11367 - 120 DAYS NO PAYMENTS/NO INTEREST

Labor:	\$11,400.00
Parts:	\$15,416.04
OL&M:	\$0.00
Misc:	\$456.33
Sales Tax:	\$4.48
Grand Total:	\$27,276.85

*** DOCUMENT COPY ***

TERMS AND CONDITIONS

Repayment Terms: Customer Disclosure - This form must be signed by the customer to process the Multi-Use Account transaction. The following special terms, as described in the Multi-Use Account credit agreement, apply to the attached invoice. Up to 120 Days No Payments / No Interest Financing followed by the ANNUAL PERCENTAGE RATE (APR) applicable to your Account.

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Credit for any returned unused parts must be made within 30 days and accompanied by this invoice. All parts returned are subject to a minimum 15% restocking fee. Open kits or electrical parts are not returnable, please refer to our return policy for details. Thank you for your business.

Received by: Date:



Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948	Invoice Number: 1048066 Invoice Date: 9/8/2017 Location: 84 Work Order Number: 188832 Payment Type: Finance Page: 1 of 8
--	--

Deliver To:

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948
--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1646	1RW9530TTAP912403	107619W	08W-388

Gen1- Retail

COMPLAINT:

\$299 KEI- 4WD TRACK INSPECTION

CORRECTION:

1. Inspect machine using checklist relative to machine.
2. Perform oil scans.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DS0251	COOLSCAN TEST KIT	1.00	31.61	31.61	\$31.61	N
IPSKIT1	OIL SCAN TEST KIT	3.00	12.46	12.46	\$37.38	N
Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
ADVPRMSVC		1.00	0.00	-68.99	(\$68.99)	N
Labor: \$299.00 Parts: \$68.99 OL&M: \$0.00 Misc: (\$68.99) Sub-Total: \$299.00						

//9530 T4WD201 Retail

COMPLAINT:


Replace the engine and cab air filters.

CORRECTION:

1. Replaced the engine air filters.
2. Replaced the cab air filters.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE187966	AIR FILTER	1.00	29.85	29.85	\$29.85	N
RE230985	AIR FILTER	1.00	77.77	77.77	\$77.77	N

CONTINUED ON NEXT PAGE->

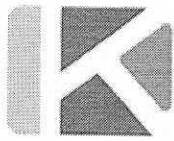

**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948	Invoice Number: 1048066 Invoice Date: 9/8/2017 Location: 84 Work Order Number: 188832 Payment Type: Finance Page: 2 of 8
--	--

Deliver To:

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948
--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1646	1RW9530TTAP912403	107619W	08W-388

//9530 T4WD201 Retail						
RE24619	AIR FILTER	1.00	33.79	33.79	\$33.79	N
RE261960	AIR FILTER	1.00	188.92	188.92	\$188.92	N
Labor: \$90.00		Parts: \$330.33	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$420.33	

//9530 T4WD93 Retail

COMPLAINT:

Software, check for updates and install via Service Advisor

CORRECTION:

1. Software, check for updates and downloaded via Service Advisor.
2. Installed the PTP and ICU software connected to the tractor with may laptop.

Labor: \$120.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$120.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

//9530 T4WD354 Retail

COMPLAINT:

VARI-COOL Fan Drive & Driven Assemblies, R&R, Recondition

CORRECTION:

CONTINUED ON NEXT PAGE->



Kibble Equipment LLC
 61022 103rd Street
 Minnesota Lake, MN 56068
 Phone: 507-462-3828
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948	<table> <tr> <td>Invoice Number:</td><td>1048066</td></tr> <tr> <td>Invoice Date:</td><td>9/8/2017</td></tr> <tr> <td>Location:</td><td>84</td></tr> <tr> <td>Work Order Number:</td><td>188832</td></tr> <tr> <td>Payment Type:</td><td>Finance</td></tr> <tr> <td>Page:</td><td>3 of 8</td></tr> </table>	Invoice Number:	1048066	Invoice Date:	9/8/2017	Location:	84	Work Order Number:	188832	Payment Type:	Finance	Page:	3 of 8
Invoice Number:	1048066												
Invoice Date:	9/8/2017												
Location:	84												
Work Order Number:	188832												
Payment Type:	Finance												
Page:	3 of 8												

Deliver To:

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1646	1RW9530TTAP912403	107619W	08W-388

//9530 T4WD354 Retail

1. Removed the bottom shroud air scoop.
2. Removed both fan shields from each side.
3. Removed the engine fan and hub.
4. Removed both belts.
5. Removed the fan drive and driven assemblies.
6. Found the driven fan shaft loose in the timing gear cover.
7. Removed the driven fan shaft and found the inner bearing was out on the shaft.
8. Removed both bearings on the shaft.
9. Installed new bearings on the driven fan shaft.
10. Cleaned up the timing cover housing and installed the fan driven shaft.
11. Replaced the seals and bushings in the driven fan sheave.
12. Cleaned all the old grease from the sheave.
13. Installed new grease in the driven fan sheave.
14. Assembled the driven fan sheave back together on the shaft as an assembly.
15. Disassembled the fan drive and cleaned up all the parts.
16. Found the piston was bad.
17. Assembled the fan drive with a new piston and new seals and new bushings.
18. Installed the fan drive assembly on the tractor.
19. Installed both belts.
20. Installed the shields.
21. Installed the air scoop.
22. Run the tractor checking operation.
23. Washed off where the work was performed.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R214319	Dowel Pin	1.00	1.74	1.74	\$1.74	N
R239551	V-BELT	1.00	74.89	74.89	\$74.89	N
R246193	WEAR RING	1.00	13.56	13.56	\$13.56	N
R246194	WEAR RING	1.00	10.92	10.92	\$10.92	N

CONTINUED ON NEXT PAGE-->



Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER
57756 - 119TH ST
MAPLETON MN 56065

Bus Phone: 507-524-3784

Prv Phone:

Mob Phone: 507-327-1948

Invoice Number: **1048066**

Invoice Date: 9/8/2017

Location: 84

Work Order Number: 188832

Payment Type: Finance

Page: 4 of 8

Deliver To:

BRIAN JAEGER
57756 - 119TH ST
MAPLETON MN 56065

Bus Phone: 507-524-3784

Prv Phone:

Mob Phone: 507-327-1948

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1646	1RW9530TTAP912403	107619W	08W-388

//9530 T4WD354 Retail

R276839	SHAFT	1.00	480.05	480.05	\$480.05	N
R301816	BUSHING	1.00	13.85	13.85	\$13.85	N
R301817	BUSHING	1.00	12.32	12.32	\$12.32	N
R308486	BACK-UP RI	1.00	9.03	9.03	\$9.03	N
R309717	BACK-UP RI	1.00	7.58	7.58	\$7.58	N
RE241242	BALL BEARI	1.00	44.90	44.89	\$44.89	N
RE264238	SEAL	1.00	21.41	21.41	\$21.41	N
RE264239	SEAL	1.00	14.07	14.07	\$14.07	N
RE301818	SEAL	1.00	18.95	18.95	\$18.95	N
RE301819	SEAL	1.00	17.23	17.23	\$17.23	N
RE313900	SEAL	2.00	18.68	18.68	\$37.36	N
RE313901	SEAL	1.00	13.05	13.05	\$13.05	N
RE346079	BALL BEARI	1.00	89.52	89.52	\$89.52	N

Labor: \$1,038.00	Parts: \$880.42	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,918.42
-------------------	-----------------	--------------	--------------	-----------------------

//9530 T4WD202 Retail

COMPLAINT:

Fuel Filters, Replace (Bleed system).

CORRECTION:

CONTINUED ON NEXT PAGE-->



Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER
57756 - 119TH ST
MAPLETON MN 56065

Bus Phone: 507-524-3784

Prv Phone:

Mob Phone: 507-327-1948

Invoice Number: **1048066**

Invoice Date: 9/8/2017

Location: 84

Work Order Number: 188832

Payment Type: Finance

Page: 5 of 8

Deliver To:

BRIAN JAEGER
57756 - 119TH ST
MAPLETON MN 56065

Bus Phone: 507-524-3784

Prv Phone:

Mob Phone: 507-327-1948

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1646	1RW9530TTAP912403	107619W	08W-388

//9530 T4WD202 Retail

1. Replaced both fuel filters.
 2. Cleaned the water separator bowl.
 3. Bled the fuel system.
- 2 EPA

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE532952	FUEL FILTER	1.00	91.76	91.76	\$91.76	N
RE533910	FUEL FILTER	1.00	115.83	115.83	\$115.83	N

Labor: \$90.00	Parts: \$207.59	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$297.59
----------------	-----------------	--------------	--------------	---------------------

//9530 T4WD405 Retail

COMPLAINT:

Light, Replace Right hand turn signal

CORRECTION:

1. Replaced the right hand rear blinker bulb in the taillight housing.
2. Checked to make sure it worked correctly.


Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE49778	BULB	1.00	1.50	1.50	\$1.50	N

Labor: \$30.00	Parts: \$1.50	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$31.50
----------------	---------------	--------------	--------------	--------------------

Gen8- Retail

COMPLAINT:

CONTINUED ON NEXT PAGE->

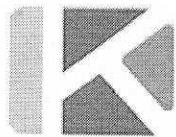

**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948	Invoice Number: 1048066 Invoice Date: 9/8/2017 Location: 84 Work Order Number: 188832 Payment Type: Finance Page: 6 of 8
--	---

Deliver To:

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948
--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1646	1RW9530TTAP912403	107619W	08W-388

Gen8- Retail

Check leaking suspension

CORRECTION:

1. Drove the tractor to air up the suspension.
2. Leaked check and found the manual relief valve leaking.
3. Replaced the manual relief valve.
4. Drove the tractor to air up the suspension.
5. Checked for leaks and found it was ok.

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
A81682	AIR FILTER	1.00	12.95	12.95	\$12.95	N
AL68589	DRAIN VALVE	1.00	27.19	27.19	\$27.19	N
L53827	O-RING	1.00	1.56	1.56	\$1.56	N
L63816	SEALING WASHER	1.00	15.59	15.59	\$15.59	N
Labor: \$113.83	Parts: \$57.29	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$171.12		

Gen9- Retail

COMPLAINT:


The alternator belt broke and come off. (NOT INCLUDED ON REPAIR QUOTE)

CAUSE:

After inspection and diagnosis I found the A/C compressor clutch bearing was locked up tight.

CORRECTION:

CONTINUED ON NEXT PAGE->

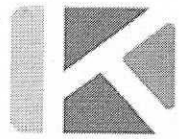

**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER
57756 - 119TH ST
MAPLETON MN 56065

Bus Phone: 507-524-3784

Prv Phone:

Mob Phone: 507-327-1948

Invoice Number: **1048066**

Invoice Date: 9/8/2017

Location: 84

Work Order Number: 188832

Payment Type: Finance

Page: 7 of 8

Deliver To:

BRIAN JAEGER
57756 - 119TH ST
MAPLETON MN 56065

Bus Phone: 507-524-3784

Prv Phone:

Mob Phone: 507-327-1948

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE 9530T

1646

1RW9530TTAP912403

107619W

08W-388


Gen9- Retail

1. Removed the left hand fan shielding.
2. Removed the shield covering the A/C compressor pulley.
3. Inspected all the idler pulleys, alternator, and A/C pulley.
4. Found only the A/C pulley to be locked up and would not spin free.
5. Connected the A/C recovery machine and recovered the refrigerant from the tractor.
6. Removed the lines from the compressor.
7. Removed the compressor from the engine.
8. Removed and replaced the receiver drier tank and o-rings for the fittings.
9. Flushed the A/C system with cleaning solvent.
10. Installed a reman A/C compressor.
11. Connected the A/C lines to the compressor with new o-rings.
12. Pulled the A/C system into a vacuum.
13. Removed the fan drive hydraulic hose.
14. Installed a new alternator belt.
15. Connected the fan drive hydraulic hose back up.
16. Charged the A/C system with R-134a refrigerant.
17. Run the tractor checking operation.
18. Removed the A/C recovery machine.
19. Installed the fan shields back on the tractor.

1 lb. R-134a

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
R183409	O-RING	2.00	1.30	1.30	\$2.60	N
R183410	O-RING	1.00	1.61	1.61	\$1.61	N
R183411	O-RING	1.00	1.77	1.77	\$1.77	N
R241746	V-BELT	1.00	26.32	26.32	\$26.32	N
RE576834	RECEIVER DRYER	1.00	47.90	47.90	\$47.90	N

CONTINUED ON NEXT PAGE->

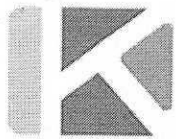

**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948		Invoice Number: 1048066 Invoice Date: 9/8/2017 Location: 84 Work Order Number: 188832 Payment Type: Finance Page: 8 of 8
---	--	--

Deliver To:

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1646	1RW9530TTAP912403	107619W	08W-388

Gen9- Retail							
SE503065	COMPRESSOR	1.00	624.44	624.44	\$624.44		N
SE503065-CR	CORE for:Compressor Reman	-1.00	30.00	30.00	(\$30.00)		N
TY15951S	LB. Shop R134A FREON (30)	1.00	9.90	9.90	\$9.90		N
TY25600	ACC-FLUSH-II QUART	1.00	46.45	46.45	\$46.45		N
Labor: \$780.00		Parts: \$730.99	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,510.99		

INVOICE CONTAINS \$0.01 DISCOUNT

Miscellaneous Charges:
SERVICE ACCESSORIES

\$125.00

Finance Information

Type: Multi-use Acct US Auth. No: 743361
 Merchant No: 44000445
 Card No: xxxxxxxxxxxx4527
 Bill Code: 704 - JD TRACTOR PARTS/SERVICE
 Credit Plan: 11382 - 120 DAYS NO PAYMENTS/NO INTEREST

Labor: \$2,560.83
Parts: \$2,277.11
OL&M: \$0.00
Misc: \$56.01
Sales Tax: \$0.00
Grand Total: \$4,893.95

*** DOCUMENT COPY ***

TERMS AND CONDITIONS

Repayment Terms: Customer Disclosure - This form must be signed by the customer to process the Multi-Use Account transaction. The following special terms, as described in the Multi-Use Account credit agreement, apply to the attached invoice.
 Up to 120 Days No Payments / No Interest Financing followed by the ANNUAL PERCENTAGE RATE (APR) applicable to your Account.

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Credit for any returned unused parts must be made within 30 days and accompanied by this invoice. All parts returned are subject to a minimum 15% restocking fee. Open kits or electrical parts are not returnable, please refer to our return policy for details. Thank you for your business.

Received by: Date:



Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065		Invoice Number:	196939
		Invoice Date:	3/24/2015
		Location:	84
		Work Order Number:	37636
		Payment Type:	Finance
Bus Phone: 507-524-3784		Page:	1 of 3
Prv Phone:	Mob Phone: 507-327-1948		

Deliver To:

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065	
Bus Phone: 507-524-3784	
Prv Phone:	Mob Phone: 507-327-1948

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1177	1RW9530TTAP912403	107619W	08W-388

Gen- Retail

COMPLAINT:

\$249 PROMO INSPECTION

CORRECTION:

- Check tractor
- Check all lights
- Check all fluid and oil levels
- Check for leaks
- Check for broken or missing parts
- Check operation of tractor and accessories

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
PROMOINSP	PROMO INSPECTION EXPENSE	1.00	0.00	-374.20	(\$374.20)	N
Labor: \$623.20		Parts: \$0.00	OL&M: \$0.00	Misc: (\$374.20)	Sub-Total: \$249.00	


Gen1- Retail

COMPLAINT:

REPAIR PER CHECK OVER
CHANGE TRANS & HYD OIL & FILTERS
CAL TRANSMISSION

CORRECTION:

CONTINUED ON NEXT PAGE->

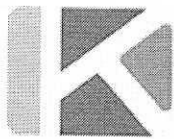

**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948	Invoice Number: 196939 Invoice Date: 3/24/2015 Location: 84 Work Order Number: 37636 Payment Type: Finance Page: 2 of 3
--	---

Deliver To:

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948
--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1177	1RW9530TTAP912403	107619W	08W-388


Gen1- Retail

- replace burnt out tail light bulb
- installed new software payload for 3 controllers
- drain all transmission, hydraulic and differential oils
- changed hyd - trans & steering filters
- refilled with cenex oil (WFS brought over)
- heated up oil for calibration
- calibrated transmission
- test drove tractor

- 3 EPA

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>
RE174130	FILTER	2.00	82.40	70.04	\$140.08	N
RE49778	BULB	1.00	3.04	3.04	\$3.04	N
RE69054	FILTER ELE	1.00	50.13	42.61	\$42.61	N
<u>Miscellaneous</u>	<u>Description</u>	<u>Quantity</u>	<u>List Price</u>	<u>Net Price</u>	<u>Extended Price</u>	<u>Taxed Ind</u>

CONTINUED ON NEXT PAGE->

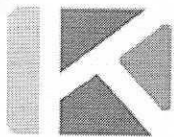

**KIBBLE
EQUIPMENT**

Kibble Equipment LLC
61022 103rd Street
Minnesota Lake, MN 56068
Phone: 507-462-3828
www.kibbleeq.com



JOHN DEERE

Invoice To Account No: 8000334

SERVICE INVOICE

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948		Invoice Number: 196939 Invoice Date: 3/24/2015 Location: 84 Work Order Number: 37636 Payment Type: Finance Page: 3 of 3
---	--	---

Deliver To:

BRIAN JAEGER 57756 - 119TH ST MAPLETON MN 56065 Bus Phone: 507-524-3784 Prv Phone: Mob Phone: 507-327-1948

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9530T	1177	1RW9530TTAP912403	107619W	08W-388

Gen1- Retail	EPA	EPA	3.00	2.00	2.00	\$6.00	N
Labor: \$960.00	Parts: \$185.73	OL&M: \$0.00	Misc: \$6.00	Sub-Total: \$1,151.73			

INVOICE CONTAINS \$32.24 DISCOUNT

Miscellaneous Charges:
SERVICE ACCESSORIES

\$79.16

Finance Information

Type: Multi-use Acct US	Auth. No: 725913
Merchant No: 44000445	
Card No: xxxxxxxxxxxx4527	
Bill Code: 120 - PARTS	
Credit Plan: 249 - PURCHASE	

Labor:	\$1,583.20
Parts:	\$185.73
OL&M:	\$0.00
Misc:	(\$289.04)
Sales Tax:	\$0.00
Grand Total:	\$1,479.89

*** DOCUMENT COPY ***

TERMS AND CONDITIONS

Repayment Terms:

This purchase(s) is subject to the terms of the multi-use account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Credit for any returned unused parts must be made within 30 days and accompanied by this invoice. All parts returned are subject to a minimum 15% restocking fee. Open kits or electrical parts are not returnable, please refer to our return policy for details. Thank you for your business.

Received by: Date: